

WAAS
CH **40021**
W01A

APP CRS
009°

Rwy Idg
TDZE **1059**
Apt Elev **1077**

RNAV (GPS) RWY 1


RUTHERFORD COUNTY/MARCHMAN FLD (FQD)

⚠

Baro-VNAV NA when using Shelby-Cleveland County Rgnl altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -17°C (2°F) or above 54°C (130°F). DME/DME RNP-0.3 NA. When local altimeter setting not received, use Shelby-Cleveland County Rgnl altimeter setting and increase all DA 77 feet, all MDA 80 feet, and increase LPV all Cats, LNAV/VNAV all Cats, LNAV Cats C/D and Circling Cats C/D visibility ¼ mile. VDP NA with Shelby-Cleveland County Rgnl altimeter setting.

MISSED APPROACH: Climb to 1700 then climbing left turn to 3000 direct EPOZI and hold.

AWOS-3 118.275	GREER APP CON ★ 119.4 350.2	UNICOM 122.8 (CTAF) 0
--------------------------	---------------------------------------	---------------------------------

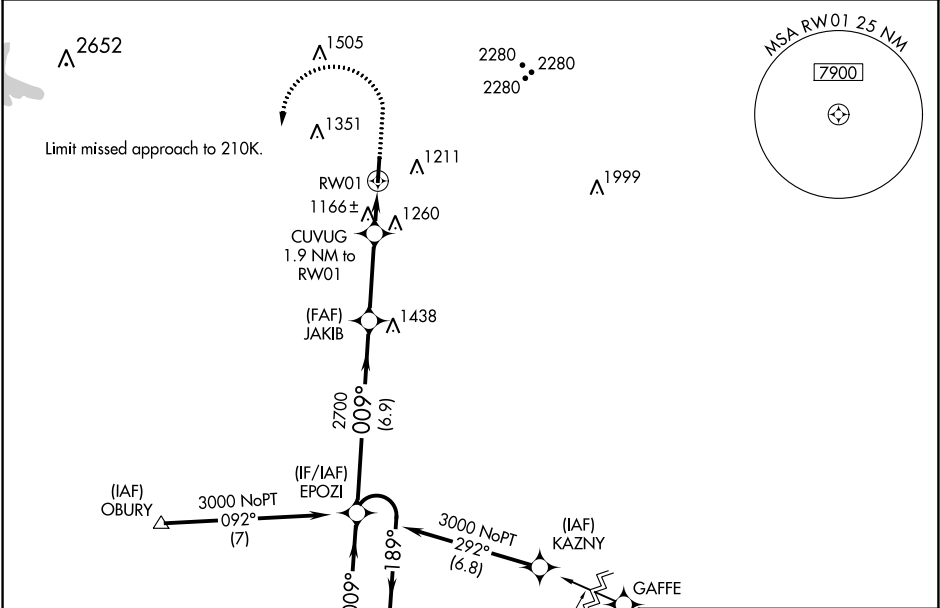

Procedure NA for arrivals at SPA VORTAC on V605 southbound.

ELEV 1077 TDZE 1059

REIL Rwy 1 and 19 0

MIRL Rwy 1-19 0

4 NM Holding Pattern				
EPOZI				
3000 ← 189° → 009° → 009°				
GP 3.00° TCH 40				
JAKIB 2700 CUVUG 1.9 NM to RW01 *1 NM to RW01 RW01				
*1700				
6.9 NM 3.1 NM 0.9 NM 1 NM				
CATEGORY	A	B	C	D
LPV DA		1309-7 ⁵ / ₈	250 (300-7 ⁵ / ₈)	
LNAV/VNAV DA		1459-13 ⁵ / ₈	400 (400-13 ⁵ / ₈)	
LNAV MDA		1420-1	361 (400-1)	
CIRCLING	1560-1 483 (500-1)	1620-1 543 (600-1)	1640-1½ 563 (600-1½)	1820-2½ 743 (800-2½)